

Ogg.: **"HD 900" FRIGGITRICI, SOSTITUZIONE LIMITATORI DI TEMPERATURA.**

Nelle friggitrici a gas ed elettriche, sono stati montati dei nuovi limitatori che intervengono (aprono i loro contatti) in caso di rottura del capillare.

**FRIGGITRICI A GAS** - Da matricola 901....., il vecchio limitatore a codice 52331 è stato sostituito dal nuovo a codice A5435.

L'intercambiabilità non è possibile per la diversa lunghezza dei bulbi, per questo motivo è stata modificata anche la vasca. Qui di seguito sono riportati i vecchi e i nuovi codici delle vasche:

Codice vecchio - nuovo	Codice vecchio - nuovo	Codice vecchio - nuovo
02112 - 05232	02121 - 05233	A5189 - A5531
59322 - 05231	59350 - 05229	A5191 - A5530
59316 - 05230	59352 - 05228	A5259 - A5532

Il vecchio limitatore, rimane disponibile a magazzino ricambi per le vecchie apparecchiature.

**FRIGGITRICI ELETTRICHE** - Da matricola 901....., il vecchio limitatore a codice 59559 è stato sostituito dal nuovo a codice 04472.

L'intercambiabilità è possibile, utilizzando due viti "M4x6" con rondelle dentate "A" come da figura e collegando elettricamente il limitatore, seguendo le indicazioni dei riferimenti da abbinare riportati nella tabella sottostante.

Obj.: **"HD 900" FRYERS, SAFETY THERMOSTATS REPLACEMENT.**

The gas and electric-heated fryers have been equipped with new safety thermostats which open their contacts if the capillary pipe breaks.

**GAS-HEATED FRYERS** - From serial number 901..... onwards, the old thermostat 52331 has been replaced by the new code A5435.


Those two thermostats are not interchangeable because of the different probes' length. This is the reason why the wells have also been modified as follows:

Old code - new code	Old code - new code	Old code - new code
02112 - 05232	02121 - 05233	A5189 - A5531
59322 - 05231	59350 - 05229	A5191 - A5530
59316 - 05230	59352 - 05228	A5259 - A5532

The old thermostat (52331) is still available at our spare parts warehouse to be fitted to old equipment.

**ELECTRIC-HEATED FRYERS** - From serial number 901..... onwards, the old thermostat 59559 has been replaced by the new code 04472.

The new part is interchangeable with the old one by using two "M4x6" screws with toothed washers (see reference "A" in the picture here below) and connecting the electric wires as described in the table underneath.

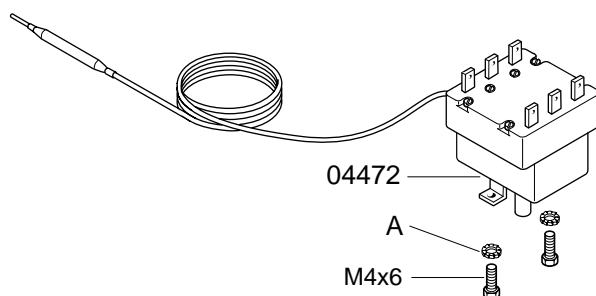

Rif. cavo Ref. cable	Rif. limitatore Ref. thermostat
1	11
2	12